




assembly instructions

# SolarSpeed 4.0 east-west landscape



# SolarSpeed components

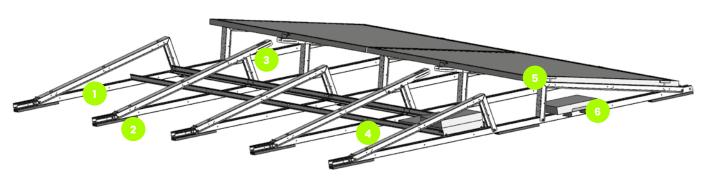

## standard components



basic unit: semi-assembled triangles + rail + protective rubbers\*



 
end rubber\*



bracket +
extension piece for
mid support



set of L-profiles



5 clamps + M8 bolts



6 ballast support

# additional components



concrete footing (12kg) + hammer plug



PP footing



C-rail end reinforcement



centre piece for set of L-profiles



ridge connection



omega bracket




anchor profile

<sup>\*</sup> For PVC roofs use rubber with aluminium underlay.



# required assembly tools

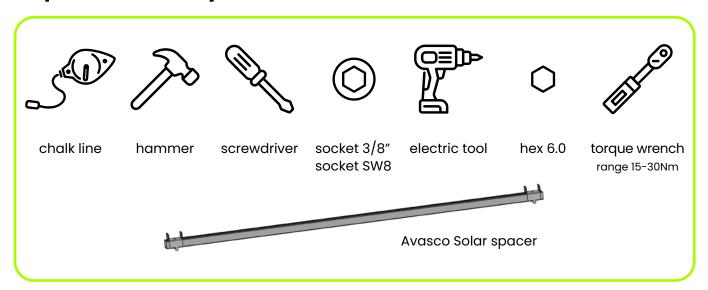


# prior to assembly

Ensure that the roof surface where the frame will be mounted on is clean, dry, and flat. Contaminants such as gravel, sand or pebbles can cause roof damage or installation instability.

# correct assembly of sheet metal screws

Prescribed compression EPDM washer: 25% of original thickness. Use tools with depth control!

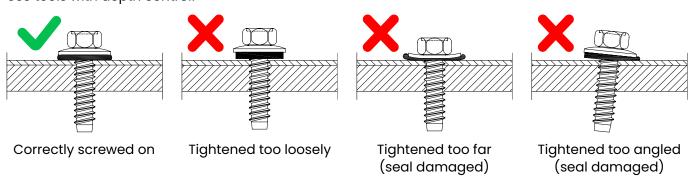

Choosing the correct installation tool is essential for the fastener to drill and tap as designed.


The selected screw gun must have a variable trigger to deliver a controlled speed between 1700 and 2000 rpm without end loading.

It should provide torque up to 30Nm with a clutch mechanism to prevent excessive torque and speed, which can cause damage or 'stripping out' the fastener. Socket 3/8" must be used with sheet metal screws, socket SW8 with self-drilling screws.



# step 1: mounting basic units

#### step 1.1: from semi-assembled to assembled basic units

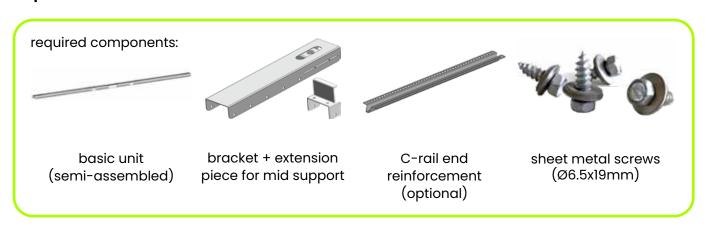






Lift the semi-assembled basic unit and bend it until the holes in the top of the triangle are alligned. Squeeze the sides of the short leg to fit them inside the longer leg while bending.





 Bend the panel stop to a 90° angle using a screwdriver.






Secure the end of assembly triangle 1 to the rail with 2 sheet metal screws (Ø6.5x19mm). Do the same with triangle 2 but only after assembling the basic units (step 1.5)

#### step 1.2: installing bracket

Install on every second assembly triangle a bracket. Secure it together with the assembly triangle on the rail with 2 sheet metal screws (Ø6.5x19mm).


The bracket will serve as a mid support for the modules.

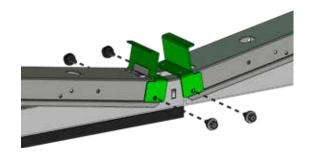

#### step 1.3: installing extension piece

Install on every second assembly triangle an extension piece. Secure it with 4 sheet metal screws (Ø6.5x19mm) in the provided holes in the assembly triangle.

The extension piece will serve as a mid support for the modules.

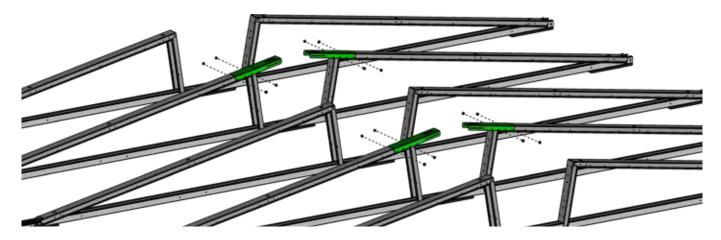




#### step 1.4: securing top of triangles

Secure the top of each assembly triangle with 2 sheet metal screws (Ø6.5x19mm).



#### step 1.5: connecting the basic units

- Place the basic units on a flat and stable roof surface.
- Connect the basic units by sliding the tapered rail end into the rail of the previous basic unit until you hear a clicking sound.
- Secure assembly triangle **2** of the previous basic unit with 2 sheet metal screws (Ø6.5x19mm).
- Every 30 metres a dilatation must be provided. See step 2.2.

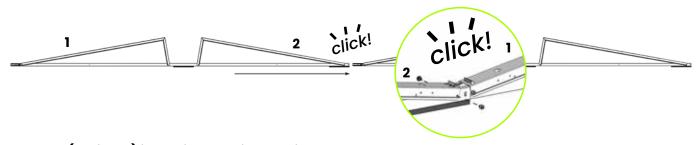

#### step 1.6: (optional) installing C-rail end reinforcement


Install the C-rail end reinforcement by sliding it between the assembly triangle and the rail. Secure it with 2 sheet metal screws (Ø6.5x19mm).

An indication of the locations can be calculated with our free online calculator. solarspeed.avasco.be.






step 1.7: (optional) installing single East or West facing module.

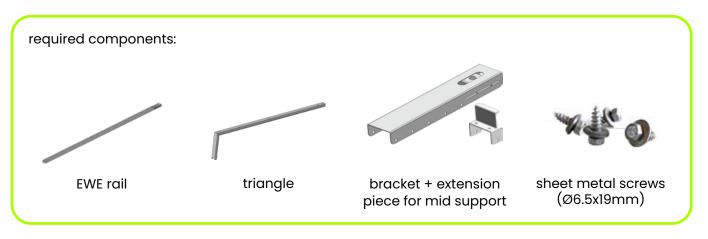

The triangle is installed in the first or the last hole of the rail as shown in the image below to create an East or West facing basic unit.

Secure the East or West facing basic unit in a similar way as described in the previous steps and install the bracket + extension piece on the mid-support.

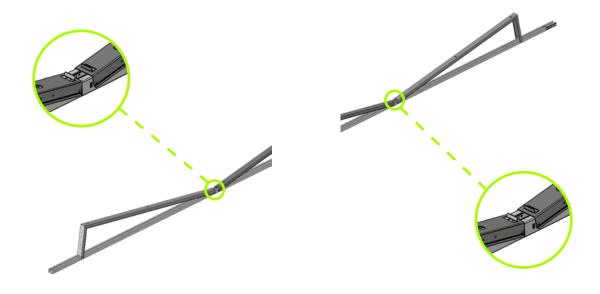




# step 2: aligning the rows

#### step 2.1: plotting the rows



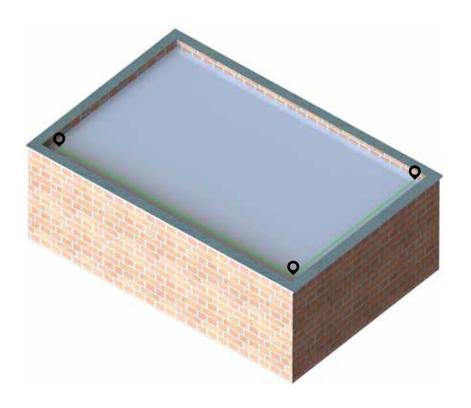


#### Tip!

Make a horizontal and vertical mark on the roof using a chalk line. When setting out the markers, respect the minimum edge zones (see general notes).



Align the rows according to plan, taking into account the length of the panels. To easily determine the distance between the basic units, you can use the spacer.

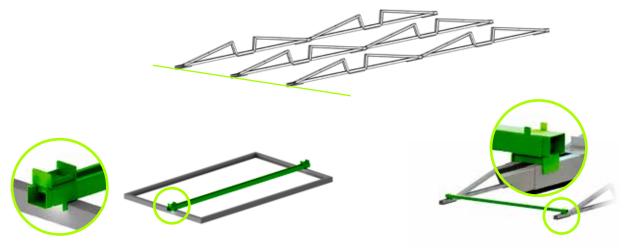


Set the length of the panel on the spacer.

Turn the spacer 180° and align the rows.

#### step 2.2: providing dilatations (thermal breaks)

In the north-south direction, also referred to as the ALU direction, a dilatation must be provided at least once every 26 metres. The distance between these 2 basic units must be at least 300mm to allow the use of ballast supports.

In the east-west direction, also referred to as the steel direction, a dilatation must be provided at least once every 30 metres.

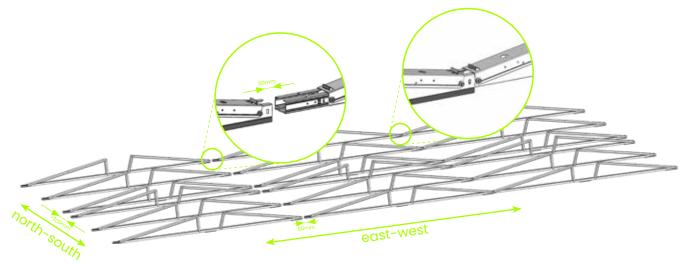




# step 3: attaching footing system

An indication of the required footing systems and ballast, their locations and the method of footing and ballasting can be calculated with our free online calculator: solarspeed.avasco.be.

Several options are possible:

- Go to step 3.1 for rubbers
- Go to step 3.2 for PP footings
- Go to step 3.3 for concrete footings
- Go to step 3.4 for mounting on metal substructure
- Go to step 3.5 for mounting with roof anchors

#### step 3.1: attaching end rubber at the end of the rail

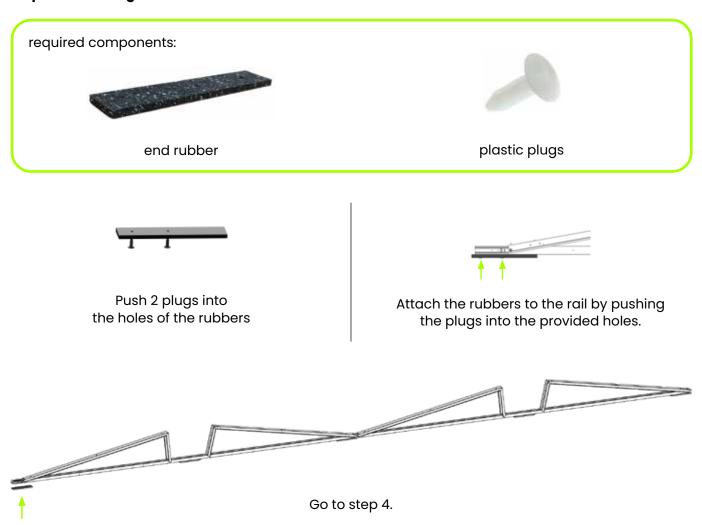



#### step 3.2: installing PP footing





PP footings are placed under the full length of the connected basic units. This means that a footing is always placed at the beginning and end of the connected basic units, as well as centrally beneath the basic unit.

The PP footing can be attached to the basic unit by securing it with 2 sheet metal screws in the provided holes in the rail of the basic unit.

The PP footings are available with or without pre-installed rubbers.



Go to step 4.

090724.ENG



step 3.3: installing concrete footing

required components:



 
concrete footing + hammer plug

 


rubber protection

A footing is placed at the beginning and the end of the connected basic units. A rubber is always placed under the concrete footings to protect the roof surface. At least 5mm of rubber must be visible on each side of the concrete footing.

In case of green or pebble roofs, remove the plants or pebbles at the places where the concrete footings need to be installed.





The hammer plug is inserted into the provided holes and hammered down. Use a screwdriver as an extension to prevent damage to the basic unit.








Go to step 4.



step 3.4: installing on metal substructure



SolarSpeed can be installed on metal substructure e.g. steeldeck, aluminium or steel profiles, ... This can be done with an omega bracket and self-drilling screws, see specific metal substructure assembly instructions.

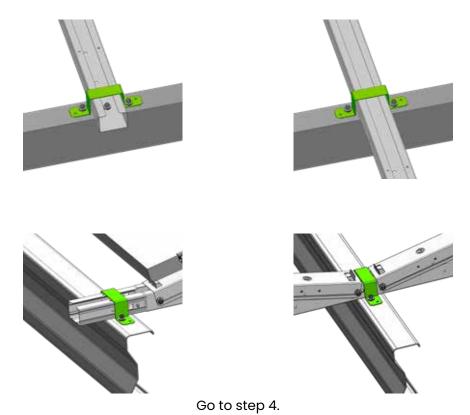




step 3.5: installing on roof anchors





Position the basic units so that the pre-installed roof anchor is precisely centered between the two C-rails. Secure the anchor profile over the roof anchor, fastening it with a washer and nut according to the roof anchor manufacturer's installation manual.

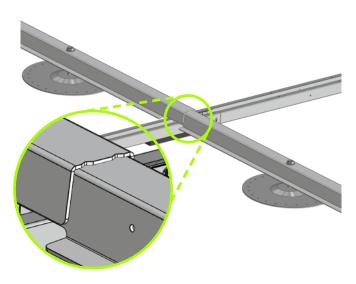

If two roof anchors are present on each side of the C-rail, the roof anchor profiles can be stacked. The widest side of the profile is identified by two indents.



# step 4: placing the ballast


An indication of the required footing systems and ballast, their locations and the method of footing and ballasting can be calculated with our free online calculator: solarspeed.avasco.be.

If the ballast report says to place an L-profile set without any ballast, you must still install at least one L-profile for mechanical and equipotential connection. You do not need to install center pieces beneath L-profiles without ballast.

#### step 4.1: providing ballast with ballast support




On the inside of the installation, the ballast can be placed on ballast supports. These can simply be placed over the rails.

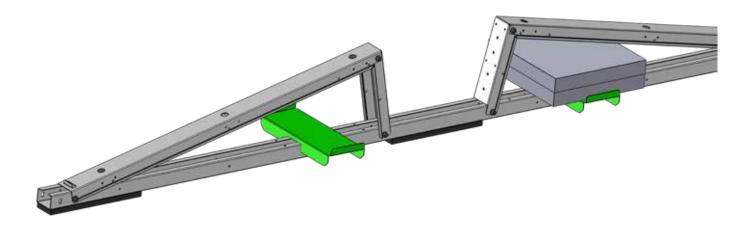



step 4.2: providing ballast with L-profiles

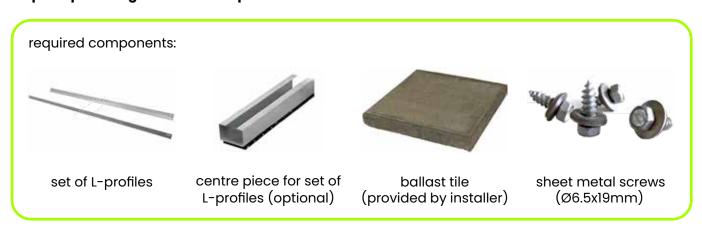

On the outer side of the installation ballast is always placed on sets of L-profiles.

The sets of L-profiles must be fixed with 4 sheet metal screws (Ø6.5x19mm) in the pre-drilled holes of the rails of the basic units (together with the optional C-rail end reinforcement).

Each optional C-rail end reinforcement must always be fixed with 4 sheet metal screws (Ø6.5x19mm) together with the L-profiles.

The optional centre piece must be placed in the centre of the L-profiles set where it can be assembled with 2 sheet metal screws (Ø6.5x19mm) in the pre-drilled holes.

For a set-up on PP footings the centre piece must also be placed on a PP footing.


For a set-up on concrete footings a higher centre piece is provided.

On the inner side of the installation sets of L-profiles are used when not enough ballast can be placed on ballast supports.






# step 5: (optional) installing backplates on the East or West facing module.

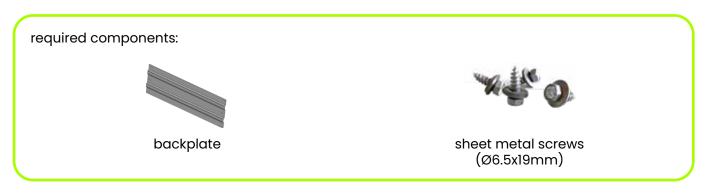

Secure the backplates with 4 sheet metal screws (Ø6.5x19mm) on each East or West facing basic unit.

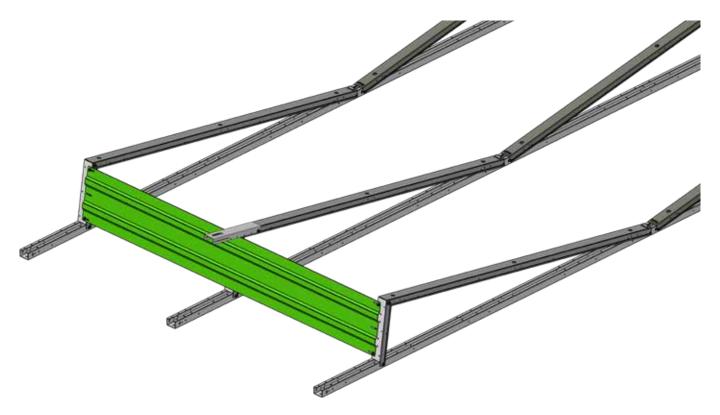




# step 5: installing ridge connection



#### step 5.1: transverse ridge connections

In the transverse direction, one ridge connection is placed on every basic unit. These are attached on top of both rails. The ridge connection wil bend to the appropriate slope when attached to the basic units. Use 4 self-drilling screws (Ø5.5x25mm) per rail.

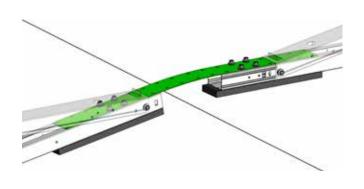

#### step 5.2: longitudinal ridge connections

In the longitudinal direction, one ridge connection is placed on every basic unit. These are attached on top of both rails. The ridge connection wil bend to the appropriate slope when attached to the basic units. Use 4 self-drilling screws (Ø5.5x25mm) per rail.






# step 6: ensuring earthing and equipotential bonding

Since the rows are electrically and mechanically interconnected, no additional connections are required between the different basic units for proper grounding.

However, the individual fields must be connected to each other with an earthing wire. This wire can be attached to the basic unit using a sheet metal screw. Ensure you use cable shoes that are not made of uncoated copper or stainless steel.

Finally, connect the SolarSpeed to the building's earthing wire.

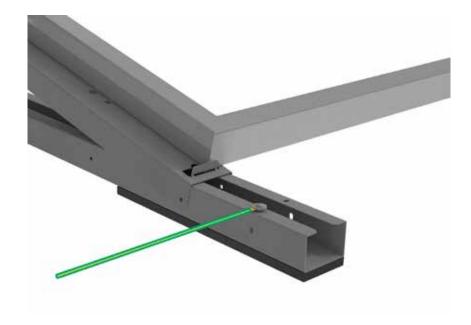



090724.ENG



# step 7: installing the modules



 

 




M8x55/55 bolt





solar panel (provided by installer)

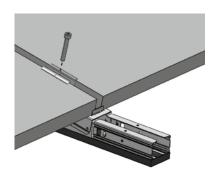


Fix the clamps into the 2 screw thread provided in the assembly triangles with the M8 bolts. Screw the 2 bolts hand tight.

After the complete solar module array has been assembled, tighten the 2 bolts with minimum 19Nm and maximum 25Nm.
(see general notes)

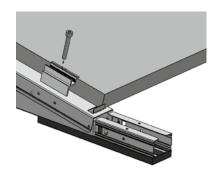

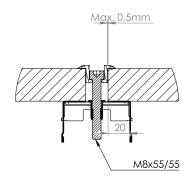

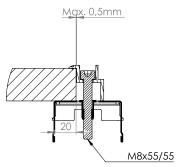



Fix end clamp into the screw thread provided in the extension pieces with an M8 bolt. Screw the bolts hand tight. After the complete solar module array has been assembled, tighten the bolts with minimum 19Nm and maximum 25Nm. (see general notes)



### general notes

- The installer should always check whether the rubber protection is sufficient when installing on soft or semi-soft surfaces. The installer should also check the compatibility of the rubber protection with the roof surface.
- Only use the clamps approved and/or recommended by the module manufacturer.
   Always tighten the clamping bolt with the correct torque: Minimum 19Nm is required, maximum 25Nm is allowed.
  - A loss of torque is to be expected: At least 13Nm must be measured during inspection after installing.
- In the following situations/circumstances, the mounting frames of Avasco Solar plc are not suitable, unless written confirmation is provided for a specific project:
  - PVC or TPO roofs with pitches > 3°
  - Bitumen or EPDM roofs with pitches > 5°
  - Places where buildings or other objects can cause a wind tunnel effect or increased wind speeds.
  - Installations closer than 2 km as the crow flies from the coastline.
  - In an aggressive environment: All materials must be in stainless steel with the correct specifications to be determined on the basis of the aggressive substances.
  - In a saline environment: Execution in anodised aluminium or stainless steel.
- Polluted roof surfaces can lead to a lower friction coefficient over time, which means that more ballast or (extra) mechanical connections must be provided to prevent sliding.
- Edge zone: The installer must always keep the minimum edge zone free as described in the applicable standard(s). An example of such a standard is the NEN7250, but this is not exhaustive.
- Installers must always provide sufficient ballast depending on the situation. In case of doubt, please contact a specialised consultancy/engineering bureau.
- It is the installer's responsibility to check if the panels can be clamped in the manner (on the short or long side, position of the clamps, etc.) as provided in this manual. If this is not the case, Avasco Solar plc can in no way be held responsible for any damage, in whatever form.
- Avasco Solar plc can never be held liable if materials are used for assembly that are not supplied by Avasco Solar plc.
- The warranty conditions with regard to the assembly frames of Avasco Solar plc are available upon request. Failure to strictly follow the assembly instructions will void all warranty.
- The installer is responsible for the use of the necessary PPE.
- Avasco Solar plc reserves the right to change the assembly instructions at any time. It is the installer's
  responsibility to always follow the latest version, which is the only valid one. This is available at all
  times on www.avasco-solar.be or can be obtained upon request.





# 100% made in Belgium

SolarSpeed is manufactured from A to Z at our production site in Ypres. As a result, we are always in control of the quality of our products, throughout the entire production process. This local production under our own management also ensures that we can respond to market demands in an extremely flexible way. The standards that are applied at all times are those of our quality management system, ISO 9001.



## on-site delivery

We always have a large number of mounting frames in stock in our warehouse. This allows us to continue to guarantee short delivery times, especially for your industrial projects. We deliver the materials directly to the site in Europe (intercontinental on demand).



Avasco Solar plc Rodenbachstraat 53 8908 Vlamertinge – Belgium T +32 (0)57 27 15 00 VAT BE 0721.474.320 info@avasco-solar.be www.avasco-solar.be

solar mounting frames